

# Icom IC-M710

## Repairs / Mods

### 2023 : No Transmit Output Power.

- Receive functions normally
- trace to - pre-drive TX buffer amp transistor - Q1 Main PCB
  - No Drive to PA from Main Board
  - TX signal present at base of Q1 but no signal at collector
  - Q1 2SC4673 sourced from eBay <https://www.ebay.co.uk/itm/322993473692>  
[<https://www.ebay.co.uk/itm/322993473692>]
  - 07/02/23 : Replaced Q1 and full transmit power restored.





